



Robert Bentley  
GOVERNOR

**ALABAMA**  
**DEPARTMENT OF TRANSPORTATION**

**AERONAUTICS BUREAU**  
1409 COLISEUM BOULEVARD  
MONTGOMERY, ALABAMA 36110  
PHONE (334) 242-6820  
FAX (334) 353-6540



John R. Cooper  
TRANSPORTATION DIRECTOR

May 13, 2011

Mr. Joe Ruffer, P.E.  
Mobile County Engineer  
Public Works, Engineering Department  
Mobile Government Plaza  
205 Government Street  
Mobile, Alabama 36644

**Subject: Annual Inspection Report**  
**Dauphin Island Airport**

Dear Mr. Ruffer:

An inspection of the Dauphin Island Airport was conducted by personnel of the Alabama Department of Transportation Aeronautics Bureau on April 22, 2011. The purpose of the inspection was to update the information currently on file regarding the airport and to ascertain compliance with the rules and regulations of the Alabama Department of Transportation governing licensed public-use airports within the State of Alabama.

Attached you will find a copy of the Annual Inspection Report for the airport. As noted in the report, the airport meets the requirements for the issuance of an operating license.

If you should have any questions concerning the inspection or corrective actions, please do not hesitate to contact the Aeronautics Bureau at (334) 242-6820.

Sincerely,

John C. Eagerton IV, D.P.A.  
Chief, Aeronautics Bureau

Copy: Mr. Rans Black, FAA/ADO  
Mr. Mike Helmsing, P.E., Volkert and Associates, Inc.

APRIL 22, 2011



## ANNUAL INSPECTION REPORT



DAUPHIN ISLAND MUNICIPAL AIRPORT

DAUPHIN ISLAND, ALABAMA

## **TABLE OF CONTENTS**

<b>INTRODUCTION.....</b>	<b>PAGE 1</b>
<b>INSPECTION METHODOLOGY.....</b>	<b>PAGE 1</b>
<b>LICENSE STATUS.....</b>	<b>PAGE 2</b>
<b>APPROACH / DEPARTURE PATHS.....</b>	<b>PAGE 2</b>
<b>PRIMARY SURFACE.....</b>	<b>PAGE 4</b>
<b>RUNWAY SAFETY AREA.....</b>	<b>PAGE 5</b>
<b>AIRPORT MARKINGS.....</b>	<b>PAGE 5</b>
<b>WIND DIRECTION INDICATOR.....</b>	<b>PAGE 6</b>
<b>AIRPORT LIGHTING.....</b>	<b>PAGE 7</b>
<b>RUNWAY, TAXIWAY AND APRON CONDITIONS.....</b>	<b>PAGE 8</b>
<b>FUELING AREA REQUIREMENTS.....</b>	<b>PAGE 8</b>
<b>PROHIBITED ACTIVITIES.....</b>	<b>PAGE 9</b>
<b>SUMMARY.....</b>	<b>PAGE 9</b>
<b>APPENDIX 1.....</b>	<b>PAGE 10</b>
<b>APPENDIX 2.....</b>	<b>PAGE 11</b>
<b>AIRPORT SAFETY SELF-INSPECTION CHECKLIST</b>	

# **Annual Inspection Report Dauphin Island Municipal Airport Dauphin Island, Alabama**

April 22, 2011

## **Introduction:**

**Code of Alabama 23-1-357(c).** The department may perform such acts, issue and amend such orders and make, promulgate, or amend general or special rules, regulations, and procedures and establish minimum standards, consistent with the provisions of this article as it shall deem necessary to carry out the provisions of this article and to perform its duties hereunder, all commensurate with and for the purpose of protecting and insuring the general public interest, health, welfare, and safety. (Act 2000-220, 10.)

In accordance with the provisions of the Code of Alabama 23-1-357(c) an inspection of the Dauphin Island Municipal Airport was conducted by Mr. Kline Jeffcoat of the Alabama Department of Transportation Aeronautics Bureau on April 22, 2011.

The corrective actions that may be prescribed in this inspection report do not relieve the airport owner from compliance with any other Federal, State or local laws, ordinances or regulations that may be applicable. It is the responsibility of the airport owner to be aware of and obey all Federal, State or local laws, ordinances or regulations that may have a bearing on the corrective actions that may be specified in this report.

## **Inspection Methodology:**

The inspection of the required State Approach/Departure Path and Federal Runway Protection Zones was accomplished by the use of approved engineering methods and equipment. The angles, locations and heights of trees or other objects within these areas were derived by the use of a Theodolite and electronic distance measuring device.

All other areas of the inspection were conducted visually and photographed for reference purposes.

The FAA Airport Design Standards referred to in this report were taken from the Airport Layout Plan (ALP) dated May 13, 2003.

# Annual Inspection Report Dauphin Island Municipal Airport Dauphin Island, Alabama

April 22, 2011

## **License Status:**

**Code of Alabama 23-1-375(a).** ...a person or municipality may not operate an airport, restricted landing area, or other air navigation facility without a license issued by the department.

Based upon the findings of the inspection conducted on April 22, 2011, it was determined that the airport **meets** the requirements for the issuance of an operating license.

The inspection was conducted on the airport under the provisions of the Administrative Code for the following areas:

### **1. Approach and Departure Paths** **Administrative Code 450-9-1-.12(1)** (See Appendix 1)

## **State Licensing Standards:**

- For all hard surface runways the approach and departure path begins 200 feet from the runway end (runway threshold).
- For all hard surface runways with a displaced threshold, the approach and departure path begins at the point of displacement (See Appendix 2).
- The approach and departure path for all runways slopes up at a ratio of 20:1.
- All penetrations of the approach and departure paths, whether natural or manmade, constitute an obstruction to navigation and must be removed.
- The land beneath the approach and departure path must be controlled by the airport owner. This is accomplished by ownership of the property in fee simple or by written perpetual agreement with the owner of the land.

## **Inspection Results:**

- Runway 12 – (See Photo # 1)
- Runway 30 – (See Photo # 2 and Appendix 2).



**Annual Inspection Report  
Dauphin Island Municipal Airport  
Dauphin Island, Alabama**

April 22, 2011

**Photo # 1 – Runway 12 Approach**



**Photo # 2 – Runway 30 Approach**



# Annual Inspection Report Dauphin Island Municipal Airport Dauphin Island, Alabama

April 22, 2011

## 2. Primary Surface Administrative Code 450-9-1-.12(2)

### State Licensing Standards:

- Primary Surface (See Appendix 1): The primary surface is 250 feet wide, centered on the runway centerline and extends 200 feet past the end of the marked runway. The primary surface is required to be free of all obstructions, manmade or natural. The only allowable objects are runway lights, guidance signs, or navigation equipment that by function is required to be within the primary surface boundaries.

### Inspection Results:

- The primary surface meets state requirements (Photo # 3).

**Photo # 3 – Primary Surface & Runway Safety Area**





**Annual Inspection Report  
Dauphin Island Municipal Airport  
Dauphin Island, Alabama**

April 22, 2011

**3. Runway Safety Area  
Administrative Code 450-9-1-.12(3)**

**State Licensing Standards:**

- Runway Safety Area (Appendix 1): All runways are required to maintain an obstruction free area adjacent to each runway. This area is 120 feet wide, centered on the runway centerline, and extends for a distance of 200 feet past the runway end. The area must be compacted and graded smooth with no ruts, humps, depressions or other potentially hazardous surface variations. The slope along the longitudinal centerline shall not exceed a rise or fall of three percent in elevation relative to the runway end elevation. The lip from the top of the pavement to the grade adjacent to the runway should not exceed 3 inches.

**Inspection Results:**

- The grade of the runway safety area meets state licensing standards (See Photo # 3).

**4. Airport Markings  
Administrative Code 450-9-1-.12(4)**

**State Licensing Standards:**

- Airport Markings: All runways are required to be marked in a manner identifying the boundaries of the landing areas. The runway markings must be painted white and be maintained in a legible condition.

**Inspection Results:**

- The airport markings are in good condition (See Photo # 4).



# Annual Inspection Report Dauphin Island Municipal Airport Dauphin Island, Alabama

April 22, 2011

**Photo # 4 – Basic & Displaced Threshold Markings**



## **5. Wind Direction Indicator Administrative Code 450-9-1-.12(5)**

### **State Licensing Standards:**

- Wind Direction Indicators: All airports are required to have an operational wind direction indicator. It must be installed in a highly visible area and free from obstructions to ensure true wind direction and velocity. Night operations require the indicator be lighted.

### **Inspection Results:**

- The wind direction indicator (wind cone) is operational and in good condition (See Photo # 5).

# Annual Inspection Report Dauphin Island Municipal Airport Dauphin Island, Alabama

April 22, 2011

Photo # 5 – Wind Cone



## 6. Airport Lighting Administrative Code 450-9-1-.12(6)

### State Licensing Standards:

- Airport Lighting: Runway lights and a lighted wind direction indicator are required for night operations. A rotating beacon is suggested. All runway, threshold, and taxiway lighting shall be maintained in operational condition and shall not be obscured by natural growth such as grass and/or weeds.

### Inspection Results:

- The results of the lighting system inspection is as follows:

Threshold Lights – 0 inoperative  
Taxiway Lights – 0 inoperative  
Runway Lights – 0 inoperative

# **Annual Inspection Report Dauphin Island Municipal Airport Dauphin Island, Alabama**

April 22, 2011

## **7. Runway, Taxiway and Apron Conditions Administrative Code 450-9-1-.12(7)**

### **State Licensing Standards:**

- Runway, Taxiway and Apron Conditions: All airport pavement surfaces associated with aircraft operations must be kept smooth and free of any defect or obstruction that could damage an aircraft. The lip of the airport pavement surfaces must not exceed three (3) inches in elevation from the top of the pavement to the shoulder. The drop should only be enough to allow sufficient drainage and not pose a control problem for aircraft exiting the runway. The aircraft parking apron is for the operation and parking of aircraft only and should be smooth and free of obstructions or defects that could cause damage to aircraft during operations.

### **Inspection Results:**

- The airport pavement surfaces are in excellent condition.

## **8. Fueling Area Requirements Administrative Code 450-9-1-.12(8)**

### **State Licensing Standards:**

- Signs should be posted prohibiting open flames or smoking in fueling areas. The fueling facility must be labeled indicating the type fuel being dispensed.
- Grounding cables must be available.
- A fire extinguisher approved for the purpose of extinguishing petroleum product fires available during all fueling operations.
- Serviceable hoses and connections that would preclude a rupture or leaking of fuel.

### **Inspection Results:**

- There is no fuel service at this airport.

**Annual Inspection Report  
Dauphin Island Municipal Airport  
Dauphin Island, Alabama**

April 22, 2011

**9. Prohibited Activities  
Administrative Code 450-9-1-.16**

**State Licensing Standards:**

- Prohibited Activities: The use of any portion of the aircraft operations area, or airport property within the boundaries of the imaginary surfaces of a licensed airport for any purpose other than the operation of aircraft shall be deemed a non-aeronautical activity and is prohibited.

**Inspection Results:**

- No prohibited activities were observed during the inspection.

**Summary:**

The table below summarizes items noted in this report.

**INSPECTION SUMMARY**

<b>Inspection Area</b>	<b>Violation/Maintenance</b>	<b>Corrective Action</b>
Airport	None found	

Included with this report is an airport safety self-inspection checklist. This checklist is taken from FAA Advisory Circular (AC) 150/5200-18C and should be used in accordance with this AC to develop your own self-inspection program.



Please contact the Aeronautics Bureau of the Alabama Department of Transportation at (334) 242-6820 with questions concerning the Annual Inspection Report.



# Annual Inspection Report Dauphin Island Municipal Airport Dauphin Island, Alabama

April 22, 2011


Approach and Departure Path Dimensions			
Inner Width	Outer Width	Length	Acreage
250 Feet	450 Feet	1,000 Feet	8.04 Acres
Primary Surface Dimensions			
250 Feet Wide Centered Along Runway Centerline			
Extending 200 Feet Past the Runway End			
Runway Safety Area Dimensions			
120 Feet Wide Centered Along Runway Centerline			
Extending 200 Feet Past the Runway End			

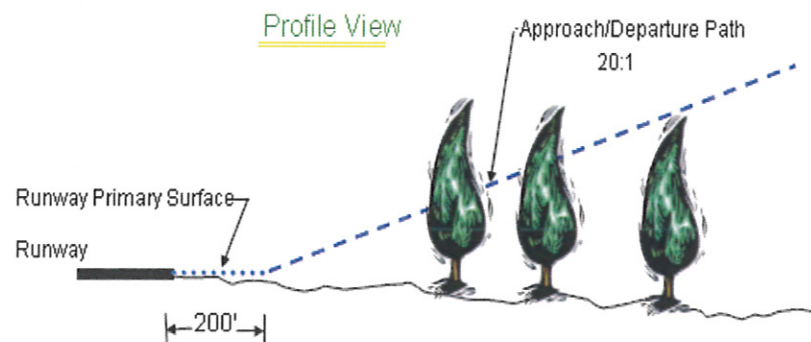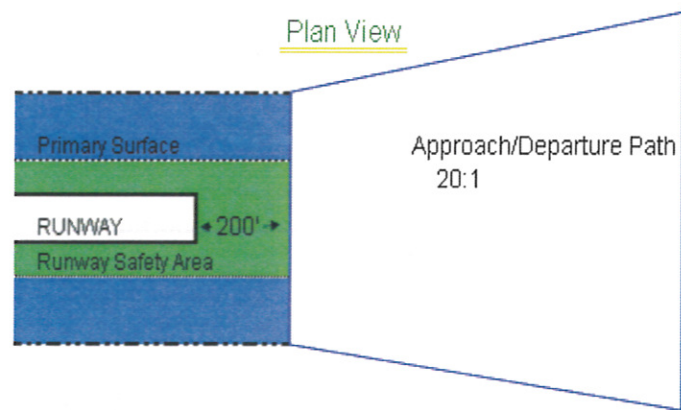

## APPENDIX 1

# DAUPHIN ISLAND MUNICIPAL AIRPORT APRIL 22, 2011


## REQUIREMENTS FOR STATE AIRPORT LICENSE RUNWAY 30

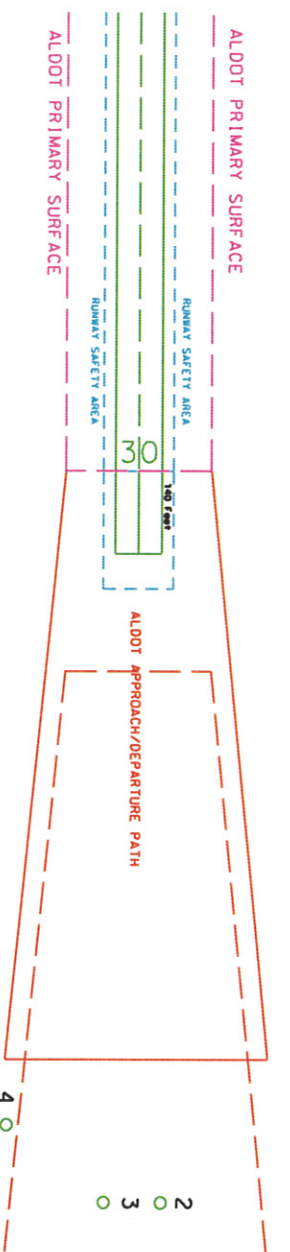

\* NO OBSTRUCTIONS

NOTE: THIS SKETCH IS PROVIDED FOR INFORMATIONAL PURPOSES ONLY AND SHOULD NOT BE USED FOR ANY OTHER PURPOSES.

DRAWING NOT TO SCALE

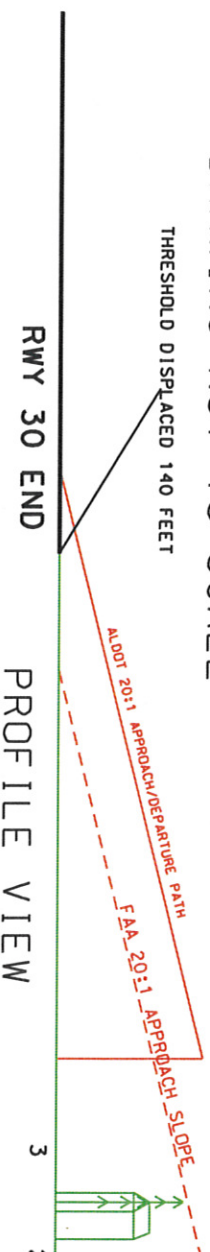

# AIRPORT SAFETY SELF-INSPECTION CHECKLIST

DATE: \_\_\_\_\_

DAY: \_\_\_\_\_

√ Satisfactory

X Unsatisfactory

Day Inspector/Time: \_\_\_\_\_ Night Inspector/Time: \_\_\_\_\_

FACILITIES	CONDITIONS	D	N	REMARKS	RESOLVED BY (Date/Initials)
Pavement Areas	Pavement lips over 3"				
	Hole – 5" diam. 3" deep				
	Cracks/spalling/heaves				
	FOD: gravel/debris/sand				
	Rubber deposits				
	Ponding/edge dams				
Safety Areas	Ruts/humps/erosion				
	Drainage/construction				
	Support equipment/aircraft				
	Frangible bases				
	Unauthorized objects				
Markings	Clearly visible/standard				
	Runway markings				
	Taxiway markings				
	Holding position markings				
	Glass beads				
Signs	Standard/meet Sign Plan				
	Obscured/operable				
	Damaged/retroreflective				

FACILITIES	CONDITIONS	D	N	REMARKS	RESOLVED BY (Date/Initials)
Lighting	Obscured/dirty/operable				
	Damaged/missing				
	Faulty aim/adjustment				
	Runway lighting				
	Taxiway lighting				
	Pilot control lighting				
Navigational Aids	Rotating beacon operable				
	Wind indicators				
	RENs/VGSI systems				
Obstructions	Obstruction lights operable				
	Cranes/trees				
Fueling Operations	Fencing/gates/signs				
	Fuel marking/labeling				
	Fire extinguishers				
	Frayed wires				
	Fuel leaks/vegetation				
Snow & Ice	Surface conditions				
	Snowbank clearances				
	Lights & signs obscured				
	NAVAIDs				
	Fire access				



